
Model: TRENTO GREY 120X120(A)

Codes: 100320171

Water absorption: BIa - Porcelanico (E<=0.1%)

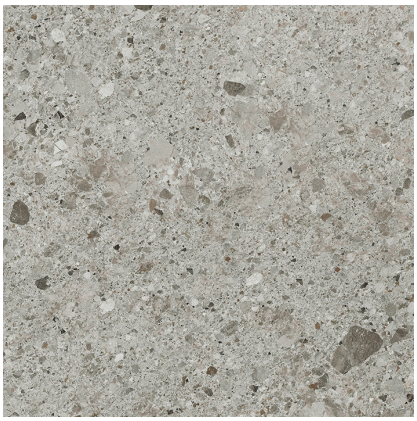

Sistema DAPc® Declaración Ambiental de Productos de Construcción

DIMENSIONAL FEATURES
UNE-EN ISO 10545-2

Thickness	11.5 MM	+/-5%*
Width	1200 MM	
Length	1200 MM	
Length and width deviation	Below 0.15%	+/-0.3%*
Side straightness deviation	Below 0.15%	+/-0.3%*
Squareness deviation	Below 0.15%	+/-0.3%*
Surface flatness deviation	Below 0.15%	+/-0.4%*

*ISO-13006:2018 UNE-EN 14411:2016

MECHANICAL FEATURES
UNE-EN ISO 10545-4-6-7-11

Breaking strength	3065.3 N	>1300N*
Modulus of rupture	37.3 N/MM2	>=35N/mm2*
Crazing resistance	Resists 3 cycles	

*ISO-13006:2018 UNE-EN 14411:2016

HYGIENIC FEATURES
UNE-EN ISO 10545-13-14:1995

Chemical resistance	Class "A" for swimming pools and cleaning products (resists attack). Minimum Class "B" for acids and bases	B Min.*
Stain resistance	Class 5. Easy cleaning with water	3 Min.*

*ISO-13006:2018 UNE-EN 14411:2016

SCOPE OF USE

Technical code-1	Use on heavy traffic floors	

ANTI-SLIP VALUE
EN 16165: 2022 / ASTM C1028

Dynamic coefficient of friction	0.69	
Slip resistance (pendulum-wet)	CL1	
Slip resistance (ramp)	R-10	16915 (2C2)*
Slip resistance (bare feet)	B	16914 (2C2)*
4s	WET-40 / DRY-57	

*ISO-13006:2018 UNE-EN 14411:2016

System Certification

Do not use cleaning agents containing hydrofluoric acid.
It is recommended to fix tiles with a minimum joint of 1,5 mm. Do not fix without joint.
For big sizes, it is recomended to fix with mortars containing polymeric additives and to use the double glueing technique.
Mosaic tiles must be grouted.
This document is only commercial and cannot be used as expert opinion, documentary evidence or in any legal or administrative procedure unless authorized by PORCELANOSA S.A.

PACKING

Sales units per box	1.440092 M2/BOX	
Sales units per pallet	54.723502 M2/PAL	
Sales units per unit	1.440092 M2/PIECE	

System Certification

Do not use cleaning agents containing hydrofluoric acid.
It is recommended to fix tiles with a minimum joint of 1,5 mm. Do not fix without joint.
For big sizes, it is recomended to fix with mortars containing polymeric additives and to use the double glueing technique.
Mosaic tiles must be grouted.
This document is only commercial and cannot be used as expert opinion, documentary evidence or in any legal or administrative procedure unless authorized by PORCELANOSA S.A.